

Manhole Inspection Summary

Manhole # S19GG2077MH

Printed On: 12/17/2008

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **19GG2** Node: **077** Status: **New Manhole (Not in GIS)** Insp Date: **4/24/07 12:00 AM**

Incomplete Comments

Crew: **JJ, BC**
Inspector: **Jensen, J**
Firm: **RKK**

Location Address: **5928 FALLS RD** Cross Street: **WASHINGTONVILLE DR**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **Sheeting**

Comments

Cover Shape: **Circular** Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **0** (in.)
Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**
Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **7** (in.)
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**
Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Barrel Material: **Brick** ☐ Parged
Shape: **Circular** Diameter: **48** (in.) Length: (in.)
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**
Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged ☐ Debris (not Condition related)
Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Steps Count: **8** Missing: **0** ☒ **Corroded**

Surcharge ☒ **Evidence Of Surcharge** Depth: **1.5** (ft.) ☐ Active Surcharge Present

Location View



Top View



Corroded steps. Evidence of surcharge - Bench debris. Channel debris.

Defect



Frame leaks. Adjustment deterioration and infiltration. Corbel and Barrel infiltration - other side.

Defect



Frame leaks. Adjustment deterioration and infiltration. Corbel and Barrel infiltration

Manhole Inspection Summary

Manhole # S19GG2077MH

Printed On: 12/17/2008

Page 3 of 4

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Barrel deterioration and infiltration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **14.21** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **1** (in.) Deposits Extent: **Light**


Infiltration: **Evidence** Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer Pipe In @ 4 O'Clock

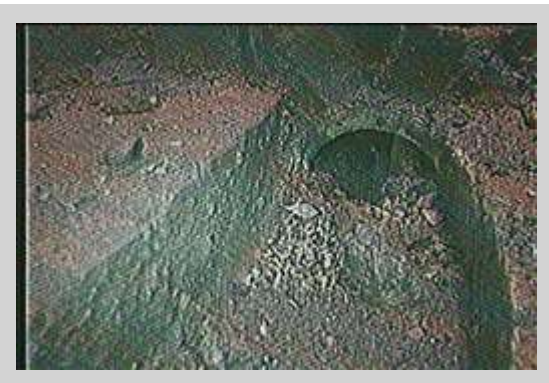

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.95** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **3** (in.) Deposits Extent: **Medium**

Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Stub connection / abandoned**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S19GG2077MH

Printed On: 12/17/2008

Page 4 of 4

8 in. Circular Gravity Sewer

Pipe In @ 7 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **14.14** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **3** (in.)

Deposits Extent: **Medium**

Infiltration: **None**

Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection